Honeywell

Montage-Anschluss-Anleitung

Verteiler 16-polig aP
Löt-Anschlusstechnik
Art.-Nr. 050025.17

Allgemeines

16-poliger aP-Verteiler für universelle Anwendung. Mit 16 Lötanschlüssen und einem Deckelkontakt (Schließer).

Technische Daten

Anschlusstechnik:	Löt/Löt
Umweltklasse nach VdS:	II
Gehäuse:	Kunststoff
Farbe:	Verkehrsweiß, ähnlich RAL 9016
Abmessungen (B x H xT):	70 x 84 x 20 mm

Installationshinweise

Achten Sie bei der Beschaltung der Lötstützpunkte auf eine sichere und saubere Verbindung zwischen Lötstützpunkt und Leitungsader.

Vor dem Schließen des Gehäuses sind die Kabel mittels Kabelbinder oder an den dafür vorgesehenen Haltern zu sichern.

Beachten Sie beim Einbau und beim Schließen des Deckels, dass der Sabotagekontakt richtig betätigt wird.

Nach der endgültigen Fertigstellung muss die Deckelschraube mit der beigefügten Schraubenplombe gesichert werden. Danach ist die Verplombung zu reinigen (fettfrei) und mit dem Aufkleber (Aufdruck VdS) abzudecken.

Nach Einbringen der Kunststoffplombe kann das Gehäuse ohne Zerstörung der Plombe nicht mehr geöffnet werden.

Anschluss-Tabelle

1		9	
2		10	
3		11	
4		12	
5		13	
6		14	
7		15	
8		16	
DK		DK	

Anschlussplan

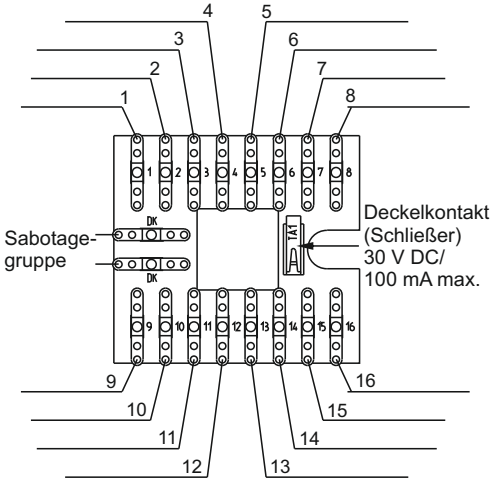

Honeywell

Mounting and Connection Instructions

Distributor 16pole s.m.
Soldering distributor
Item no. 050025.17

General

Surface mounted soldering distributor for connections. With 16 soldering fittings with 2 tongues and a cover contact (NO-contact).

Technical data

Connection technology:	solder/solder
Protection class as per VdS:	II
Housing:	Plastic
Colour:	Traffic white (similar to RAL 9016)
Dimensions (W x H x D):	70 x 84 x 20 mm

Installation notes

When switching the soldering base points please take care that the connection between soldering base point and core is save and clean.

Before closing the housing, secure the cable with a cable tie or at the provided pull relief clamp.

Please observe when installing and closing the cover of the housing, that the tamper contact will switch correct and accurate.

After the final mounting the cover screws must be locked with screw sealings. Clean the seal (free from grease) and cover with the label (VdS imprint).

After attaching the plastic seal, the housing cannot be opend without destroying the seal.

Connecting-List

1		9	
2		10	
3		11	
4		12	
5		13	
6		14	
7		15	
8		16	
CC		CC	

P02827-10-00201

Connection diagram

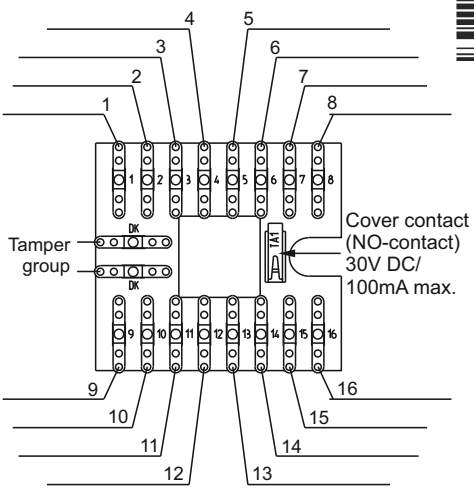

Honeywell Security Group
Novar GmbH
Johannes-Mauthe-Str. 14
D-72458 Albstadt

Subject to change without notice

Honeywell